



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D212-664-101
Job Sheet 194164



Part No: D212-664-101

Job Qty: 1 pcs

Part Name: Fwd Crosstube - High



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 4/26/19

Job Tracking No:

Due Date: 5/17/19

Created By: Shannon Hadley

Type: Stock

Description:

Note: D212-664-141 REV E/ IIN-D212-664 REV.J IPP Rev:E 04.02.16 Reformat KJ/DS IPP Rev:F 06-03-29 Remove
Comments on Pick List JLM IPP Rev:G 07-04-30 As per Rev C JLM IPP Rev:H 11.04.26 inspection strip ecn 11-
549 EC verf by:DD IPP REV:I 14.05.27 AS PER ECN 14-570 DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
110	Packaging 1 - Pick Kit	1 pcs		5/17/19	0.00	0.00	Packaging 1 - 1		
							Packaging 1 - 2		
							Packaging 1 - 3		
							Packaging 1 - 4		
							Packaging 1 - 5		
							Packaging 1 - 6		
							Packaging 1 - 7		
							Packaging 1 - 8		
							Packaging 1 - 9		
							Packaging 1 - 10		
							Packaging 1 - 11		
							Packaging 1 - 12		
							Packaging 1 - 13		
							Packaging 1 - 14		
							Packaging 1 - 15		
							Packaging 1 - 16		
							Packaging 1 - 17		
							Packaging 1 - 18		
							Packaging 1 - 19		
							Packaging 1 - 20		
							Packaging 1 - 21		
							Packaging 1 - 22		
							Packaging 1 - 23		
							Packaging 1 - 24		
							Packaging 1 - 25		
							Packaging 1 - 26		
							Packaging 1 - 27		
							Packaging 1 - 28		
							Packaging 1 - 29		
							Packaging 1 - 30		

BB 5/1/2019



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No: S177161



Part: D212-664-101

Job No: 194164

Serial No/Batch: S177161

Revision: E/J

Inspector:

Exp Date:

Instructions: TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA ST



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No: S177161



Part: D212-664-101

Job No: 194164

Serial No/Batch: S177161

Revision: E/J

Inspector:

Exp Date:

Instructions: TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA ST

					Packaging 1 - 31	
					Packaging 1 - 32	
					Packaging 1 - 33	
					Packaging 1 - 34	
					Packaging 1 - 35	
					Packaging 1 - 36	
120	Crosstubes - Bend - 2 - B4B	1 pcs	5/17/19	3.11 1.00	Crosstubes - Bend - B4B	BB 5/1/2019
130	QC 15	1 pcs	5/17/19	0.00 0.00	QC 15 - 12	
					QC 15 - 3	
					QC 15 - 47	
					QC 15 - 49	
					QC 15 - 58	
					QC 15 - 9	
					QC 15 - 68	
140	Crosstubes - 2 - B4B	1 pcs	5/17/19	0.00 1.00	Crosstubes - 1 - B4B	
					Crosstubes - 2 - B4B	GP 19-01-03
					Crosstubes - 3 - B4B	
					Crosstubes - 4 - B4B	
150	Crosstubes - 3 - B4B	1 pcs	5/17/19	0.00 0.50	Crosstubes - 1 - B4B	
					Crosstubes - 2 - B4B	
					Crosstubes - 3 - B4B	GP 19-01-03
					Crosstubes - 4 - B4B	
160	QC 7	1 pcs	5/17/19	0.00 0.00	QC 7 - 10	
					QC 7 - 13	
					QC 7 - 14	
					QC 7 - 15	
					QC 7 - 17	
					QC 7 - 18	
					QC 7 - 19	
					QC 7 - 2	
					QC 7 - 28	
					QC 7 - 3	
					QC 7 - 30	
					QC 7 - 34	
					QC 7 - 36	
					QC 7 - 37	
					QC 7 - 41	
					QC 7 - 47	
					QC 7 - 48	
					QC 7 - 51	
					QC 7 - 58	
					QC 7 - 59	
					QC 7 - 60	
					QC 7 - 9	
					QC 7 - 68	MAY 03 2019 DAS 68
					QC 7 - 50	9-89
					QC 7 - 67	
					QC 7 - 40	
165	QC 5	1 pcs	5/17/19	0.00 0.00	QC 5 - 10	
					QC 5 - 12	
					QC 5 - 17	
					QC 5 - 18	
					QC 5 - 19	
					QC 5 - 22	
					QC 5 - 24	
					QC 5 - 3	
					QC 5 - 43	
					QC 5 - 49	

				QC 5 - 51	
				QC 5 - 58	DAS
				QC 5 - 68	MAY 03 2019 68
				QC 5 - 9	9-89
				QC 5 - 50	
				QC 5 - 30	
				QC 5 - 40	
170 Outsource - 2 - NDT per QSI038	1 pcs	5/17/19		SKY002-VC	HY 2019-05-07
180 Packaging 2-1 - Receive - B4B	1 pcs	5/17/19	0.00 0.00	Packaging 2 - 1 - B4B	
				Packaging 2 - 2 - B4B	
				Packaging 2 - 3 - B4B	
				Packaging 2 - 5 - B4B	MAY 07 2019
				Packaging 2 - 4 - B4B	
				Packaging 2 - 6 - B4B	
				Packaging 2 - 7 - B4B	
				Packaging 2 - 8 - B4B	
				Packaging 2 - 9 - B4B	
				Packaging 2 - 10 - B4B	
				Packaging 2 - 11 - B4B	
				Packaging 2 - 12 - B4B	
				Packaging 2 - 13 - B4B	
				Packaging 2 - 14 - B4B	
				Packaging 2 - 15 - B4B	
				Packaging 2 - 16 - B4B	
				Packaging 2 - 17 - B4B	
				Packaging 2 - 18 - B4B	
				Packaging 2 - 19 - B4B	
				Packaging 2 - 20 - B4B	
				Packaging 2 - 21 - B4B	
				Packaging 2 - 22 - B4B	
				Packaging 2 - 23 - B4B	
				Packaging 2 - 24 - B4B	
				Packaging 2 - 25 - B4B	
				Packaging 2 - 26 - B4B	
				Packaging 2 - 27 - B4B	
				Packaging 2 - 28 - B4B	
				Packaging 2 - 29 - B4B	
				Packaging 2 - 30 - B4B	
				Packaging 2 - 31 - B4B	
				Packaging 2 - 32 - B4B	
				Packaging 2 - 33 - B4B	
				Packaging 2 - 34 - B4B	
				Packaging 2 - 35 - B4B	
				Packaging 2 - 36 - B4B	
190 QC 5	1 pcs	5/17/19	0.00 0.00	QC 5 - 10	
				QC 5 - 12	
				QC 5 - 17	
				QC 5 - 18	
				QC 5 - 19	
				QC 5 - 22	
				QC 5 - 24	
				QC 5 - 3	
				QC 5 - 43	
				QC 5 - 49	
				QC 5 - 51	
				QC 5 - 58	DAS
				QC 5 - 68	MAY 07 2019 68
				QC 5 - 9	9-89

200	Spray Paint - 2 - B4B	1 pcs	5/17/19	0.00 0.25	QC 5 - 50	
					QC 5 - 30	
					QC 5 - 40	
					Spray Paint - 1 - B4B	AR 19-5-4
					Spray Paint - 2 - B4B	
					Spray Paint - 3 - B4B	
					Spray Paint - 4 - B4B	
					Spray Paint - MJ1 - B4B	
					Spray Paint - MJ2 - B4B	
210	QC 14	1 pcs	5/17/19	0.00 0.00	Spray Paint - MJ3 - B4B	
					Spray Paint - MJ4 - B4B	
					QC 14 - 15	
					QC 14 - 2	
					QC 14 - 34	
					QC 14 - 41	
					QC 14 - 51	
					QC 14 - 58	
					QC 14 - 59	
					QC 14 - 9	
					QC 14 - 68	DAS MAY 08 2019 68
220	Crosstubes - 4 - B4B	1 pcs	5/17/19	0.00 1.69	QC 14 - 40	9-89
					QC 14 - 19	
					Crosstubes - 1 - B4B	
					Crosstubes - 2 - B4B	
230	QC 5	1 pcs	5/17/19	0.00 0.00	Crosstubes - 3 - B4B	
					Crosstubes - 4 - B4B	AR 19-5-5
					QC 5 - 10	
					QC 5 - 12	
					QC 5 - 17	
					QC 5 - 18	
					QC 5 - 19	
					QC 5 - 22	
					QC 5 - 24	
					QC 5 - 3	
					QC 5 - 43	
					QC 5 - 49	
					QC 5 - 51	
					QC 5 - 58	
					QC 5 - 68	DAS MAY 08 2019 68
					QC 5 - 9	9-89
					QC 5 - 50	
					QC 5 - 30	
					QC 5 - 40	
240	Packaging 1-1 - Pick Kit - B4B	1 pcs	5/17/19	0.00 0.00	Packaging 1 - 1 - B4B	
					Packaging 1 - 2 - B4B	
					Packaging 1 - 3 - B4B	
					Packaging 1 - 4 - B4B	
					Packaging 1 - 5 - B4B	
					Packaging 1 - 6 - B4B	
					Packaging 1 - 7 - B4B	
					Packaging 1 - 8 - B4B	
					Packaging 1 - 9 - B4B	
					Packaging 1 - 10 - B4B	
					Packaging 1 - 11 - B4B	
					Packaging 1 - 12 - B4B	
					Packaging 1 - 13 - B4B	

				Packaging 1 - 14 - B4B	
				Packaging 1 - 15 - B4B	
				Packaging 1 - 16 - B4B	
				Packaging 1 - 17 - B4B	
				Packaging 1 - 18 - B4B	
				Packaging 1 - 19 - B4B	
				Packaging 1 - 20 - B4B	
				Packaging 1 - 21 - B4B	
				Packaging 1 - 22 - B4B	
				Packaging 1 - 23 - B4B	
				Packaging 1 - 24 - B4B	
				Packaging 1 - 25 - B4B	
				Packaging 1 - 26 - B4B	
				Packaging 1 - 27 - B4B	
				Packaging 1 - 28 - B4B	
				Packaging 1 - 29 - B4B	
				Packaging 1 - 30 - B4B	
				Packaging 1 - 31 - B4B	
				Packaging 1 - 32 - B4B	
				Packaging 1 - 33 - B4B	
				Packaging 1 - 34 - B4B	
				Packaging 1 - 35 - B4B	
				Packaging 1 - 36 - B4B	
250 QC 4	1 pcs	5/17/19	0.00 0.00	QC 4 - 28	
				QC 4 - 58	
				QC 4 - 69	
				QC 4 - 9	
				QC 4 - 46	
				QC 4 - 68	
260 Packaging 3-1 - Stock - B4B	1 pcs	5/17/19	0.00 0.00	Packaging 3 - 1 - B4B	
				Packaging 3 - 2 - B4B	
				Packaging 3 - 3 - B4B	
				Packaging 3 - 4 - B4B	
				Packaging 3 - 5 - B4B	
				Packaging 3 - 6 - B4B	
				Packaging 3 - 7 - B4B	
				Packaging 3 - 8 - B4B	
				Packaging 3 - 9 - B4B	
				Packaging 3 - 10 - B4B	
				Packaging 3 - 11 - B4B	
				Packaging 3 - 12 - B4B	
				Packaging 3 - 13 - B4B	
				Packaging 3 - 14 - B4B	
				Packaging 3 - 15 - B4B	
				Packaging 3 - 16 - B4B	
				Packaging 3 - 17 - B4B	
				Packaging 3 - 18 - B4B	
				Packaging 3 - 19 - B4B	
				Packaging 3 - 20 - B4B	
				Packaging 3 - 21 - B4B	
				Packaging 3 - 22 - B4B	
				Packaging 3 - 23 - B4B	
				Packaging 3 - 24 - B4B	
				Packaging 3 - 25 - B4B	
				Packaging 3 - 26 - B4B	
				Packaging 3 - 27 - B4B	
				Packaging 3 - 28 - B4B	
				Packaging 3 - 29 - B4B	
				Packaging 3 - 30 - B4B	

PC. MAY 07 2019

				Packaging 3 - 31 - B4B	
				Packaging 3 - 32 - B4B	
				Packaging 3 - 33 - B4B	
				Packaging 3 - 34 - B4B	
				Packaging 3 - 35 - B4B	
				Packaging 3 - 36 - B4B	
265 DC - 1 - B4B	1 pcs	5/17/19	0.00 0.00	DC - 1 - B4B	DAG
				DC - 2 - B4B	21
270 QC 21 - FG	1 pcs	5/17/19	0.00 0.00	QC 21 - FG - 21	9-88 MAY 24 2019
				QC 21 - FG - 70	DAG
				QC 21 - FG - 53	21
					9-88 MAY 24 2019

Part Op 120 - Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101
 Descriptions: 130 - (QC15- Crosstube Dimensional Check)
 140 - "1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10 2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes. 3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141 4-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141"
 150 - HandFinish5 (Crosstubes Chemical Conversion) ***IMMEDIATELY AFTER GRINDING***
 160 - (QC7-Inspect Chemical Conversion Coat)
 165 - QC5- Inspect part completeness to step on W/O)
 170 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order
 180 - (Receive & Inspect for Damage & Mat'l Certs) Ensure copy of NDT results attached to work order.
 190 - (QC5- Inspect part completeness to step on W/O) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D212-664-141
 200 - (Spray Paint / NDT Room) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** 1-Prime inside & outside crosstube as per QSI 005 4.2 BATCH: 5154137 2- After painting remove masking and apply matte clear coat per QSI005 4.2 3- MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG BEFORE PAINTING 4 -Paint Outside of Tube as per Dart QSI 005 4.2 clear sisH67 Paint 5173197
 210 - (QC14- Inspect Spray Paint) Then, Wrap in plastic bag to protect from scratches
 220 - *****LAY DOWN CROSSTUBE ON TABLE AND PUT DT10302 PINS IN SADDLE HOLE FACING UP, USE HOLE IN TAPE MASURE TO PUT IN PINS FOR LOCATING CENTER OF CROSSTUBE. ***** 1- Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg 2- Install supports with Proseal 890 per D212-664-141 and QSI 015 A/R Proseal 890 Batch: 5146134 EXP: 10/19
 PROSEAL CURE TIME 72 HOURS: Start: 19-5-5 Finish: 19-5-8 3- Install clamps with rubber cushion (ENSURE CLAMPS ARE INSTALL ON TOP SIDE OF CROSSTUBE) using DT9565 as per Dwg D212-664-141. ***Torque all clamps to 80-100 IN-LBS.***
 230 - (QC5- Inspect part completeness to step on W/O) ***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 72HOURS AS PER DWG.***
 240 - (Pick Kit)
 250 - QC4- 100% Inspect kits for completeness) ***VERIFY BY _____ BATCH # TO MATCH W/O
 260 - (Identify as per dwg & Stock Location: _____) Identify and pack for shipping as per PPP D212-664-101 Location : FG094
 265 - Photocopy bluefile and create labels as per PPP D212-664-101 CHG006
 270 - (QC21- Final Inspection - Work Order Release)

Job BOM


Part / Item	Component Name	Quantity	Operation	Container
D212-664-101TRN	Crosstube Turning Detail	1 pcs (1 ea)	110-Packaging 1 - Pick Kit	5175436
D2893-1	Support	2 pcs (2 ea)	220-Crosstubes - 4 - B4B	
D3595-063-450	Rubber Cushion 0.63" Wide X 4.50" Long	4 pcs (4 ea)	220-Crosstubes - 4 - B4B	
MS21920-25	Clamp	4 Ea (4 ea)	220-Crosstubes - 4 - B4B	
AN6-35A	Bolt	4 Ea (4 ea)	240-Packaging 1-1 - Pick Kit - B4B	5054116x3 5623 691x1
AN6-36A	Bolt	4 Ea (4 ea)	240-Packaging 1-1 - Pick Kit - B4B	5166700
D3428-1	Placard	1 pcs (1 ea)	240-Packaging 1-1 - Pick Kit - B4B	5112841
MS21042L6	Nut	6 Ea (6 ea)	240-Packaging 1-1 - Pick Kit - B4B	5149182
NAS1149D0663J	Washer	18 Ea (18 ea)	240-Packaging 1-1 - Pick Kit - B4B	5138105

Job Allocations				
Operation	Component Part	Required	Inventory	Allocated
110-Packaging 1 - Pick Kit	D212-664-101TRN	1	4	0
220-Crosstubes - 4 - B4B	D2893-1 <i>S173692</i>	<i>2</i>	21	0
	D3595-063-450 <i>S177076</i>	<i>4</i>	21	0
	MS21920-25 <i>SH2130</i> <i>1</i>	<i>4</i> <i>S173047</i> <i>3</i>	89	0
240-Packaging 1-1 - Pick Kit - B4B	AN6-35A	4	71	0
	AN6-36A	4	65	0
	D3428-1	1	36	0
	MS21042L6	6	366	0
	NAS1149D0663J	18	1,296	0
Part Specifications				
Specifications could not be found.				

Plex 4/26/19 8:18 AM Dart.Hadley.Shannon

DART AEROSPACE LTD		Work Order: 194164
Description: Crosstube High Fwd (205/212/412)		Part Number: D212-664-101
Inspection Dwg: D212-664-141 Rev: E		Page 1 of 1

Required Dimension	Min	Max
Height	26.67	27.17
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7
Bending Passes	3	--
Crushing	--	7.2%

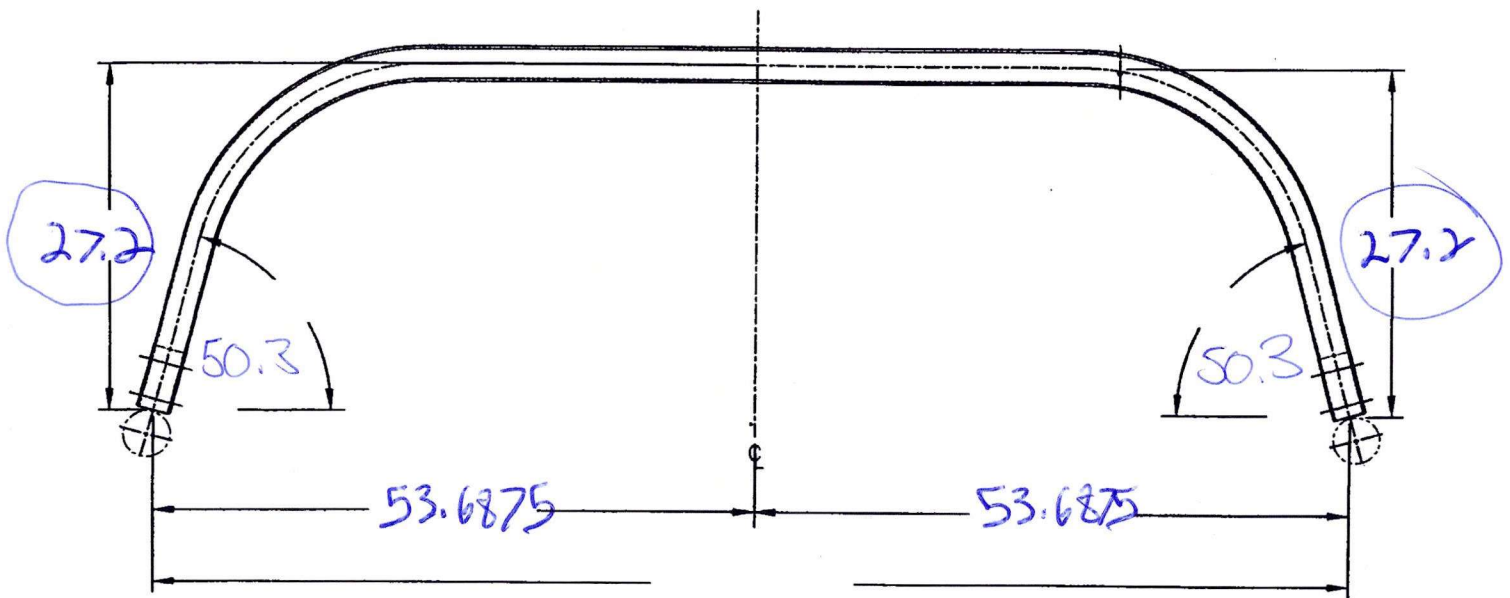

	Side A	Side B
Bending Passes	4	4
Crushing	4.2%	4.3%
Comments		

2.302

2.505

2.302

2.508

QC15 Inspection	
Date	19-05-01

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.07.28	Revised max crushing %	KJ	
F	16.01.15	Revised Height min/max dimensions	KJ	

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
4	1	1	1	D6005-128	CROSSTUBE
5	2		2	D2893-1	SUPPORT
6	4	4	4	D3595-063-450	RUBBER CUSHION
7		2		D5017-1	SUPPORT
8	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
9	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT
***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- WEIGHT: D212-664-141/-141B/-141F = 33.6 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 8% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

WORK ORDER
NO. 19372745
140422

RELEASED
2014-05-26
WD



E	ADD -141F. D5017-1 WAS D2893-1 (-141B). PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL. ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (B7-2, B7-3). BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3). INCOMP. DEO D-1/-2/-3	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6388, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D212-664-141 REV. E
SHEET 1 OF 5

TITLE XTUBE ASSY (205/212/412 HI FWD) SCALE NTS

COPYRIGHT © 2009 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

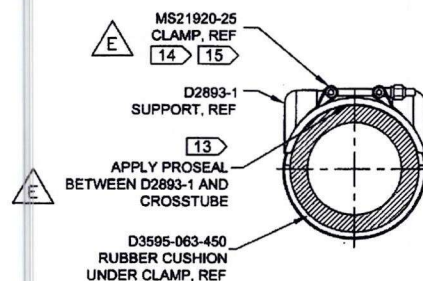
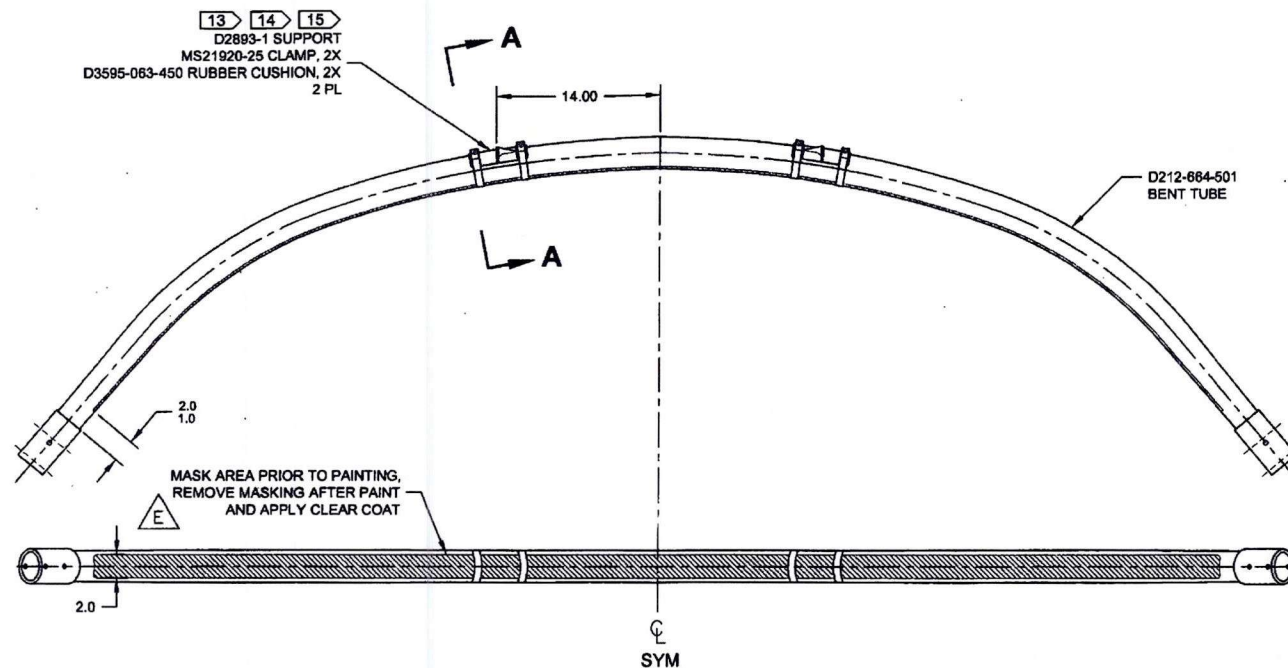


SECTION A-A
SCALE 4X

D212-664-141/-141F
ASSEMBLY DETAIL

RELEASED
2014-05-26
AND

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

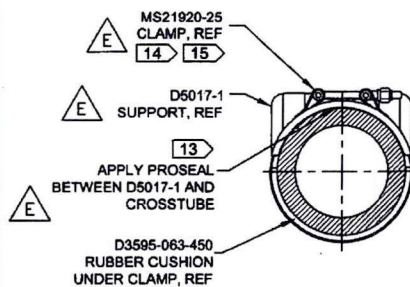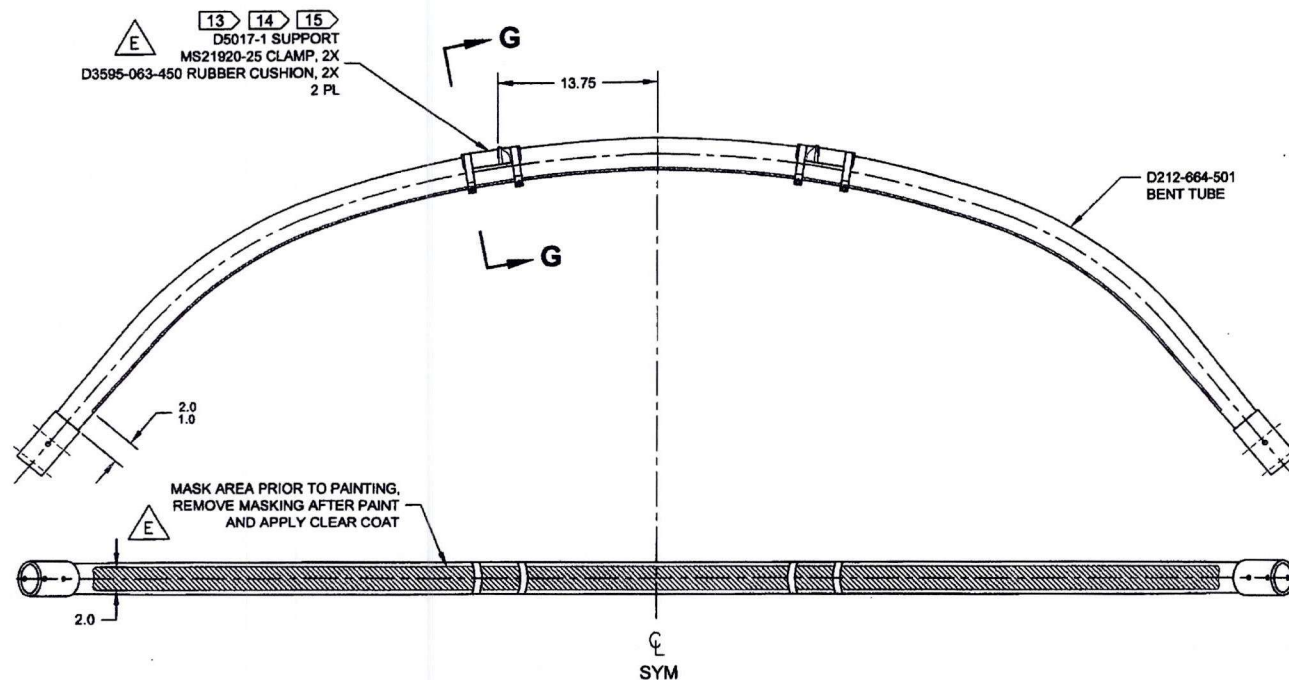


SECTION G-G
SCALE 4X


D212-664-141B
ASSEMBLY DETAIL

RELEASED
2014-05-26


DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 3 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

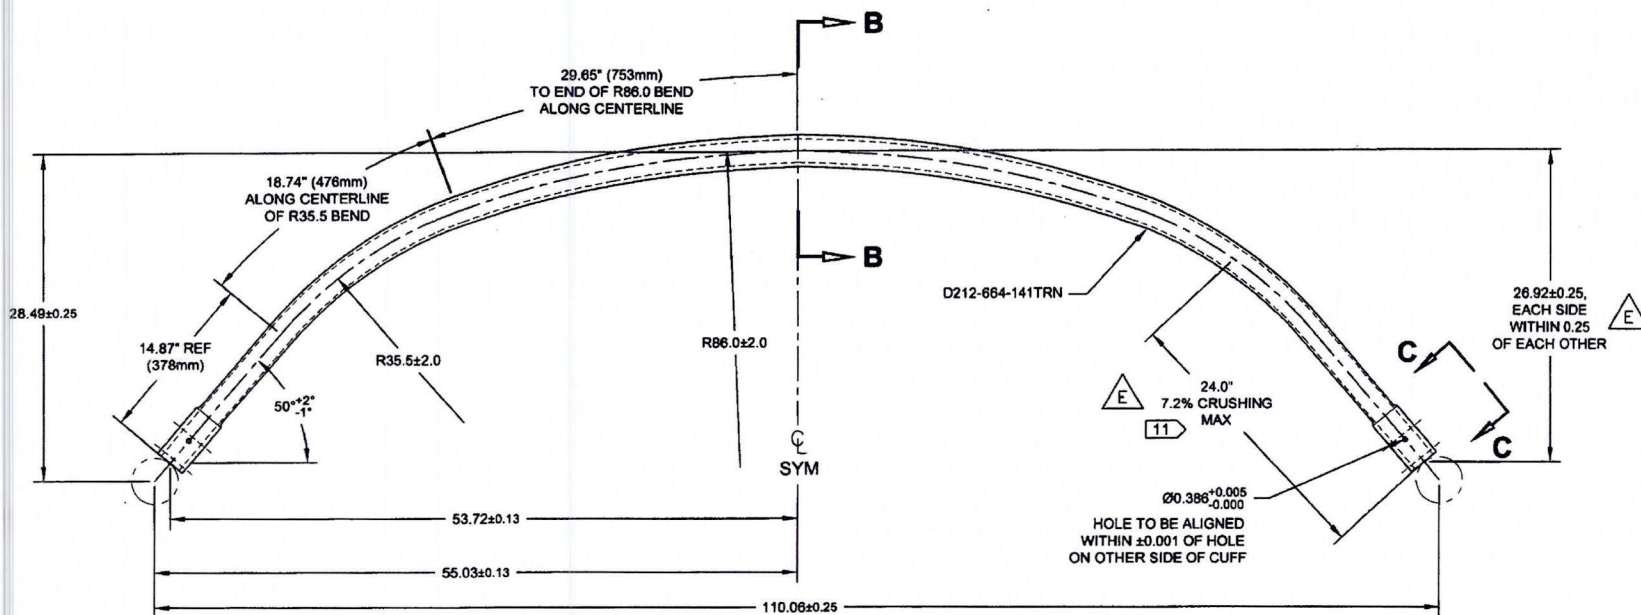

D212-664-501
BENDING AND DRILLING DETAIL 11

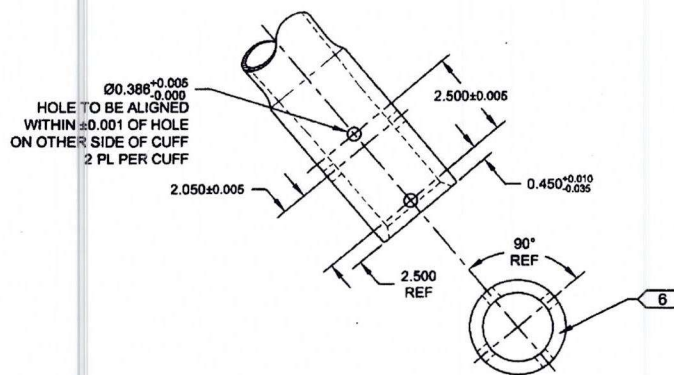


VIEW C-C: CUFF DETAIL
 SCALE 3X

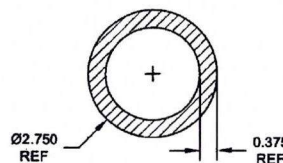

SECTION B-B
 SCALE 4X

RELEASED
 2014-05-26

DESIGN	<i>Q</i>	DART AEROSPACE LTD	
DRAWN	<i>Q</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>Q</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>Q</i>	D212-664-141	SHEET 4 OF 5
APPROVED	<i>Q</i>	TITLE	SCALE
DE APPR.	<i>Q</i>	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

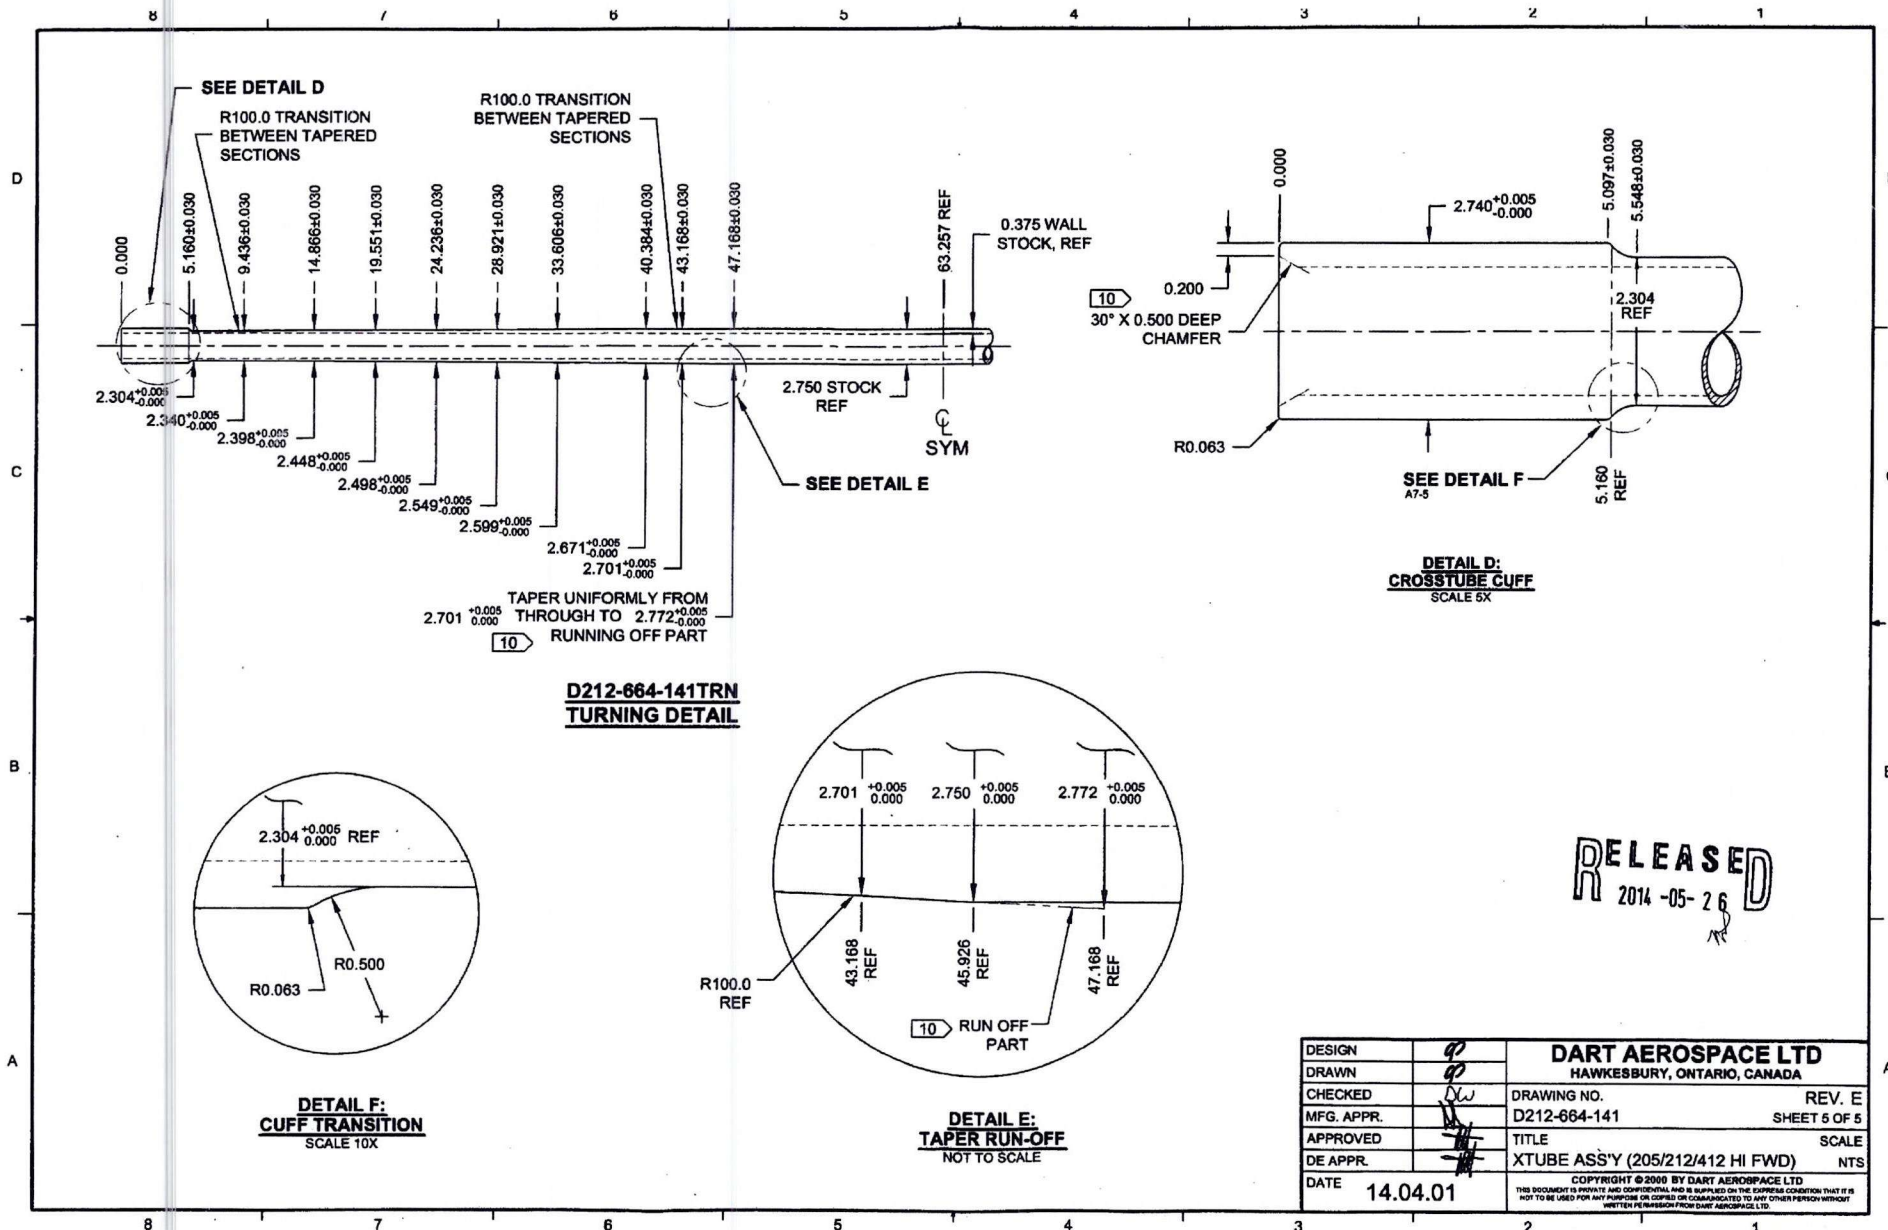

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐					
Date : 16/5/1		Sequence #:		QTY Affected :		MRB (QSI042) INSP 12 16/5/1	
Description Work Order Deviation				Disposition			
Height is over tolerance by 0.03				Acceptable. Will not cause fit issue.			
				Completed By 16/5/1			
				Lead hand / Supervisor			
				QC / QA Coordinator			
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread					
		Other/Details:					



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER

POHB043372



Supplier: SKY002-VC
Skyservice
6120 Midfield Road
Mississauga
ON
L5P 1B1 Canada
Phone: 905-678-5636
Fax: 905-678-5841

Attention: Jenne, Heather

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

PO No: POHB043372

PO Date: 5/3/19

Due Date: 5/7/19

Purchase Order

Revision:

Revision Date:

Ship-To Contact: Phone:

Via: Ground

Pymt Terms: Net 30

Freight Terms:

Special Comments:

Items

Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	187116	D4883-7	End Fitting : Various STC's Outsource process - NDT per QSI038 4.1 Issue P/O: LPI Per ASTM 1417 LEVEL 2 Certificate of conformaty is required.	Firmed	-	5/7/19	6 pcs	0 pcs	6 pcs	\$18.50/pcs	\$111.00
2	187764	D4884-3	End Fitting, Eye : Various STC's Outsource process - NDT per QSI038 4.1	Firmed	-	5/7/19	6 pcs	0 pcs	6 pcs	\$18.50/pcs	\$111.00
3	192351	D407-667-105	Fwd Crosstube - High 407 : TC STC SH01-5 Issue 3, FAA STC SR01304NY 05/12/15, JCAB JAPAN STC-32-OSA 02/02/28, EASA STC EASA.IM.R.S.01179 06/07/03, BRAZIL 2009S08-16 09/08/25, BRAZIL 2009S08-17 09/08/25 Outsource process - NDT per QSI038 4.1 *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** OUTSIDE SERVICE -CROSSTUBES Liquid Penetrant Inspection as per QSI 038 Or Level 2 Attach copy of NDT results to work order	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	186544		IX MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	186545		IX MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	186546		IX MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
Sub Total:							4	0	4		\$444.00



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER

POHB043372



Items

Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
4	194162	D212-664-101	Fwd Crosstube - High : TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA STC EASA.IM.R.S.01304 07/03/06, DGAC MEXICO STC IA-316/2015 15/06/17 *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	194167		<i>1 X</i> MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	194161		<i>1 X</i> MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	194164		<i>1 X</i> MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
Sub Total:							4	0	4		\$444.00

AS
68
89

5	192361	D407-667-205	Aft Crosstube - High 407 : TC STC SH01-5 Issue 3, FAA STC SR01304NY 05/12/15, JCAB JAPAN STC-32-OSA 02/02/28, EASA STC EASA.IM.R.S.01179 06/07/03, BRAZIL 2009S08-16 09/08/25, BRAZIL 2009S08-17 09/08/25 *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038O	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	194110		<i>1 X</i> MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
	194111		<i>1 X</i> MAY 07 2019	Firmed	-	5/7/19	1 pcs	0 pcs	1 pcs	\$111.00/pcs	\$111.00
Sub Total:							3	0	3		\$333.00

Grand Total: \$1,443.00



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER

POHB043372



Order Notes

Procurement Quality Clauses

A005 right of entry
A012 chemical and physical test report
A016 personnel qualification
A017 raw material identification (as applicable)

A022 Apical Processing
A024 process certifications
A026 certification of material conformance

A041 quality management system
A042 dart notification by supplier
A043 retention of quality documents

A048 counterfeit parts avoidance, detection, mitigation and disposition program

A049 supplier awareness

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 5/7/19 10:43 AM Dart.Guerin.Kimberley

**skyservice****Work Order Traveler**

Sky Service F.B.O. Inc.

10195 Ryan Avenue, Dorval, Quebec, H9P 1A2

TCCA AMO 53-89 / EASA 145.7142 / BDA AMO 385


WO #: MWO40272	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: POHB043372 ✓
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:**CARRY OUT NDT ON:**

- ✓ 4 FWD CROSSTUBES, P/N# D407-667-105, J/S# 192351, 186544, 186545, 186546
- ✓ 4 FWD CROSSTUBES, P/N# D212-664-101, J/S# 194161, 194162, 194163, 194167
- ✓ 3 AFT CROSSTUBES, P/N# D407-667-205, J/S# 194110, 192361, 194111
- ✓ 6 END FITTINGS, P/N# D4883-7, J/S# 187116
- ✓ 6 END FITTING EYE, P/N# D4884-3, J/S# 187764

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-16						MAY 03 2019	 
NO CRACK FOUND							
PEN. ZL-56, MPO13600, CLEANER SKC-S MPO13923, DEV. MPO11715, UV LIGHT M-20142							
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

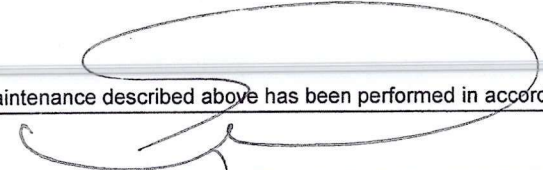Signature: 	ACA/SCA Stamp 	Date: MAY 03 2019
Name: RAFIK MELIKIAN		

REFERENCE ONLY

5.0 PARTS LIST

5.1 HIGH GEAR CROSSTUBES

Item	QTY -101	QTY -201	QTY -203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21920-26)
13	4			AN6-35A	BOLT
14	4			AN6-36A	BOLT
15	6			MS21042L6	NUT (OR MS21042-6)
16	18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21920-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21920-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	1	1		D3428-1	PLACARD

* REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/-241 OR D412-664-243 ASSEMBLIES ABOVE.

NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AAI SKIDTUBES.

PAGE 1 OF 1

Description: CROSSTUBE INSTALLATION, HIGH FWD

H:\Forms\Engineer\Approved Eng Online\CHGREC revB